



FEDERAL MINISTRY OF ENVIRONMENT
HYDROCARBON POLLUTION REMEDIATION PROJECT (HYPREP)
REPORT OF HYPREP ACTIVITIES IN THE MONTH OF JUNE 2021

1.0 REMEDIATION WORKS

1.1 STATUS OF ON-GOING REMEDIATION WORKS AT PHASE 1 BATCH 1 SITES

Remediation works resumed at four (4) of the five (5) outstanding Lots in Batch 1. These are Lot 009, 012, 013 and 016 respectively.

At Lot 009 (Saanaiko - Mogho, Gokana L.G.A), the Contractor completed backfilling of the pit wherefrom the impacted soil was excavated and treated, and carried out the general levelling of the site. The site is proposed for NOSDRA Close-out/Certification Sampling in July 2021.

At Lot 012, (Debon –Bodo/Mogho, Gokana L.G.A), the Contractor is concluding the final backfilling of the excavated pits.

At Lot 013 (Nweekol Zorbuke –K.Dere, Gokana L.G.A), the Contractor has resumed backfilling of excavated segment of the pit, in preparation for the commencement of excavation and treatment of the last segment of the delineated impacted area.

At Lot 016 (Buemene Korokoro Well 5, Tai L.G.A), the Contractor has started preparing the site to continue backfilling of ready segment of excavated pit as well as the excavation and treatment of other unattended parts of the delineated impacted area.



Plate 1.1: Lot 009 (Saanaiko) in Mogho, Gokana L.G.A after backfilling of excavated pits and general site levelling. (Contractor: ODUN ENVIRONMENTAL LTD).



Plate 1.2: Concluding phase of the final backfilling of the excavated pits at Lot 012 Debon, Bodo/Mogho, Gokana L.G.A (Contractor: SHAMSA RESOURCES& SERVICES LTD).

Detailed information of remediation work performance status of the remaining five (5) Lots in Batch 1 is summarized in Table 1.1 below:

S/N	LOT NR.	REMEDATION CONTRACTOR	SITE NAME/ COMMUNITY	L.G.A.	PERFORMANCE PERCENTAGE (%)
1.	009	Odun Environmental Ltd	Saanako, Mogho	Gokana	95
2.	011	Mosvinny Nig. Ltd	Debon, Bodo / Mogho	Gokana	84
3.	012	Shamsa Resources & Services Ltd	Debon, Bodo / Mogho	Gokana	92
4.	013	Centennial Devt. & Investments Ltd	Nweekol Zorbuke, K.Dere	Gokana	84
5.	016	Newline West Africa Ltd	Buemene Well 005, Korokoro	Tai	58

Table 1.1: Performance Status of outstanding Sites in Batch 1 Remediation Works

Detailed information of remediation work performance status of the twenty-one (21) Lots in Phase 1, Batch 1 is summarized in Table 1.2 below:

S/N	LOT NR.	REMEDATION CONTRACTOR	SITE (SITE NAME, COMMUNITY)	L.G.A.	STATUS	PERFORMANCE PERCENTAGE (%)
1	001	Nautilus Nigeria Engineering Construction Ltd	Okenta, Alode	Eleme	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
2	002	Basic Nigeria Technology Ltd	Oboolo, Ebubu	Eleme	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
3	003	Pacrim Engineering Ltd	Nkeleoken, Alode	Eleme	Awaiting analytical results and recommendations from NOSDRA Close-out/Certification Sampling.	98

4	004	RDK Environmental EcoSolutions Ltd	Nkeleoken, Alode	Elemo	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
5	005	Earthpro Unique Integrated Services Ltd	Nkeleoken, Alode	Elemo	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
6	006	Environmental Resources Managers Ltd	Nkeleoken, Alode	Elemo	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
7	007	Avondale Services and Supplies Ltd	Nkeleoken, Alode	Elemo	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
8	008	Giolee Global Resources Ltd	Nkeleoken, Alode	Elemo	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
9	009	Odun Environmental Ltd	Saanako, Mogho	Gokana	Planned for NOSDRA Close-out/Certification processes in July 2021.	95
10	010	Rey & Reina International Ltd	Debon, Bodo & Mogho	Gokana	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
11	011	Mosvinny Nigeria Ltd	Debon, Bodo & Mogho	Gokana	Concluding phase of site works still pending. Site not active.	84
12	012	Shamsa Resources & Services Ltd	Debon, Bodo & Mogho	Gokana	Planned for NOSDRA Close-out/Certification processes in July 2021.	92
13	013	Centennial Development & Investments Ltd	Nweekol Zorbuke, K. Dere	Gokana	Excavation and treatment of impacted soil.	84
14	014	Navante Oil & Gas Company Ltd	Nweekol Zorbuke, K. Dere	Gokana	Completed remediation NOSDRA Close-out / Certification Processes successfully.	98
15	015	Secura Investments Ltd	Wiiiborsi, Kpean	Khana	Awaiting analytical results and recommendations from NOSDRA Close-out/Certification Sampling.	98
16	016	Newline West Africa Ltd	Buemene Korokoro Well 5, Korokoro	Tai	Excavation and treatment of impacted soil.	58
17	017	Tip Tree Inter-Trade Nigeria Ltd	Bara Akpor, Botem	Tai	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
18	018	Louizioni Ferreti Ent. Ltd	Buemene Korokoro Well 9, Korokoro	Tai	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
19	019	Asonic Associates Ltd	Buemene Korokoro Well 8, Korokoro	Tai	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
20	020	Amazing Environmental Solutions International Ltd	Buemene Korokoro Well 8, Korokoro	Tai	Completed remediation NOSDRA Close-out / Certification Processes successfully.	100
21	021	Newpal Nigeria Ltd	Aabue/Ueken Korokoro Well 6,	Tai	Awaiting analytical results and recommendations from NOSDRA Close-	98
	21 LOTS	21 Contractors	9 Sites, 12 Communities	4 L.G.As	13 Lots Close-out, 3 Awaiting NOSDRA Close-out Results, 2 Planned for NOSDRA Close-out Processes in July 2021, 2 Still Working, 1 Not Active.	2,005
Average Work Done (%)						95.48

Table 1.2: Details of Status of Lots in Phase 1 Batch 1 HYPREP Remediation Works.

1.2. STATUS OF ON-GOING REMEDIATION WORKS AT PHASE 1, BATCH 2 SITES

Active remediation works have been completed at one (1) out of the twenty-nine (29) lots in Batch 2 (Lot 043). The lot is awaiting NOSDRA analytical results and close-out recommendations upon the completion of the sampling phase of the Close-out/Certification process.

Six (6) Lots in Batch 2 have completed site works and are awaiting NOSDRA Close-out/Certification processes proposed for July 2021. These are Lots 024, 026, 030, 042, 045 and 056. Active remediation works (site set-up, excavation and treatment of impacted soil, QA/QC Monitoring of treated soil volumes, backfilling of excavated pits with treated soil, general leveling of site, installation and sampling of remediation groundwater defensive boreholes respectively) are going on at other twenty-one (21) lots while Lot 032 has not yet commenced any active site activities.

Details of Lots in Batch 2 are presented in Table 1.3 below:

Lot Number(s)	Communities	Status
043 (1 Lot, 1 Site)	Aleto (Eleme L.G.A)	Awaiting results of NOSDRA Certification and Close out.
024, 026, 030, 042, 045, 056 (6 Lots, 5 Sites)	B.Dere/Gio (Gokana/Tai L.G.A); Korokoro (Tai L.G.A); Aleto (Eleme L.G.A); Akpajo (Eleme L.G.A);	Completed Remediation. Proposed for NOSDRA Certification & Close-out.
022, 023, 025, 028, 029, 031, 034, 044, 046, 047, 048, 054 (12 Lots, 6 Sites).	B.Dere/Gio (Gokana/Tai L.G.A), Bara Alue (Tai L.G.A); Koro koro (Tai L.G.A); Aleto, Akpajo, Ogale (Eleme L.G.A).	Nearing completion of Remediation works.
027, 033, 049, 050, 051, 052, 053, 055, 057 (9 Lots, 4 Sites).	Bara Alue (Tai L.G.A); B.Dere/Gio (Gokana/Tai L.G.A); Akpajo (Eleme L.G.A);	Ongoing Remediation and siteworks at different stages of completion
032 (1 Lot, 1 Site)	B.Dere/Gio (Gokana/Tai L.G.A).	Yet to commence site works.

Table 1.3: Works Status of Lots in Batch 2 Remediation Works

Details on Excavation/Earthwork Status at Lots in Batch 2 are presented in Table 1.4 below:

Status of Excavation and Treatment Works	Lot Numbers	Number of Lots	Site(s)
COMPLETED	024, 026, 030, 042, 043, 045 & 056	7	B.Dere/Gio in Gokana/Tai L.G.A , Korokoro in Tai L.G.A, Aleto (Ngofa) and New Elelenwo Mfd, Akpajo in Eleme L.G.A respectively.
COMMENCED / ON-GOING	022, 023, 025, 031, 033 & 034	15	B.Dere/Gio in Gokana/Tai L.G.A
	029		Aabue Korokoro Flow Station in Tai L.G.A.
	044		Aleto (Ngofa) in Eleme L.G.A.
	046		Nsioken, Akpajo in Eleme L.G.A
	028		Bara Alue in Tai L.G.A.
	057		New Elelenwa Manifold, Akpajo in Eleme L.G.A.
YET TO COMMENCE	047, 048, 051 & 054	7	Okuluebu, Ogale in Eleme L.G.A.
	032		B.Dere/Gio in Gokana/Tai L.G.A
	027		Bara Alue in Tai L.G.A.
	049, 050, 052, 053 & 055		Okuluebu, Ogale in Eleme L.G.A.
		29 Lots	

Table 1.4: Details of Status of Excavation Works at Lots in Phase 1 Batch 2 HYPREP Remediation Works.



Plate 1.3: A panoramic view of the remediated area after backfilling and general site leveling at Lot 056 (New Elemenwa Manifold, Akpajo, Eleme L.G.A). (Remediation Contractor= AWA ENGINEERING COY LTD).



Plate 1.4: Ongoing excavation of impacted soil from delineated area for treatment at Lot 048 (Okuluebu, Ogale in Eleme L.G.A). (Remediation Contractor= SLOT ENGINEERING NIG. LTD).



Plate 1.5: Quality Assurance / Quality Control (QA/QC) and Remediation Execution Officers from the Operations Unit of HYPREP collecting QAQC Monitoring Samples from treated soil volumes with the Contractor representatives at Lot 028 (Bara Alue, Tai L.G.A). (Remediation Contractor = EMAMEDNIG. LTD).

Detailed information of remediation work performance status of Phase 1 Batch 2 sites is summarized in Table 1.5 below:

S/N	LOT NR.	REMEDATION CONTRACTOR	SITE NAME	L.G.A.	STATUS	PERFORMANCE PERCENTAGE (%)
1	022	Vitruvian Global Resources Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil.	55
2	023	Cascade Engineering Systems Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil.	72
3	024	Levene Energy Dev Ltd	B. Dere / Gio	Gokana / Tai.	Planned for NOSDRA Close-out/Certification processes in July 2021.	79
4	025	Subadom Global Resources Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil.	53
5	026	Earthquest Int'l Ltd	B. Dere / Gio	Gokana / Tai.	Planned for NOSDRA Close-out/Certification processes in July 2021.	95
6	027	Marm Consulting Services Ltd	Bara Alue	Tai	Commenced setting up of site office.	6
7	028	Emamed Nig Ltd	Bara Alue	Tai	Excavation and treatment of impacted soil.	56
8	029	Weafri Well Services Ltd	AABUE Korokoro Flow Station (FS)	Tai	Excavation and treatment of impacted soil.	53
9	030	ElizaxBleet Nig Ltd	AABUE Korokoro Flow Station (FS)	Tai	Planned for NOSDRA Close-out/Certification processes in July 2021.	86
10	031	Oilserv Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil in progress.	64

11	032	Mosito Environmental Ltd	B. Dere / Gio	Gokana / Tai.	Yet to establish physical presence on site.	2
12	033	Christohouston Energy Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil.	32
13	034	DLK Oil & Gas Ltd	B. Dere / Gio	Gokana / Tai.	Excavation and treatment of impacted soil in progress.	76
14	042	Kanny Koy Ltd	Korokor0 W-4	Tai.	Planned for NOSDRA Close-out/Certification processes in July 2021.	92
15	043	Otaoilf Services Ltd	AletoNgofa	Eleme	Awaiting analytical results and recommendations from NOSDRA Close-out/Certification Sampling.	98
16	044	M/S Harrisco Int'l Ltd	AletoNgofa	Eleme	Excavation and treatment of impacted soil.	49
17	045	Chavyn Nig Ltd	AletoNgofa	Eleme	Planned for NOSDRA Close-out/Certification processes in July 2021.	86
18	046	Andelsta Ltd	NsiokenAkpajo	Eleme	Construction of engineered biocell at completion phase, excavation commenced.	30
19	047	Lapideo Multi Services Ltd	Ajeokpori W-3 Okuluebu	Eleme	Excavation and treatment of impacted soil.	45
20	048	Slot Eng Nig Ltd	Ajeokpori W-3 Okuluebu	Eleme	Excavation and treatment of impacted soil.	50
21	049	Environ Consult & Remedial Service Ltd	Ajeokpori W-3 Okuluebu	Eleme	Site office set-up, biocell construction.	17
22	050	Klartek Nig Ltd	Ajeokpori W-3 Okuluebu	Eleme	Setting up of site office and biocell construction.	17
23	051	Erotina Nig Ltd	Ajeokpori W-3 Okuluebu	Eleme	Excavation and treatment of impacted soil.	29
24	052	Montego Upstream Services Ltd	Ajeokpori W-3 Okuluebu	Eleme	Setting up of site office and biocell construction at advance stages of completion.	20
25	053	Atlas- Ray & Sons Coy Ltd	Ajeokpori W-3 Okuluebu	Eleme	Completion of biocell construction.	19
26	054	Brant Technologies Ltd	Ajeokpori W-3 Okuluebu	Eleme	Excavation and treatment of impacted soil.	50
27	055	ADG Int'l Resources Ltd	Ajeokpori W-3 Okuluebu	Eleme	Site office set-up and biocell construction.	15
28	056	Awa Engineering Coy Ltd	New Elelenwo Manifold, Akpajo	Eleme	Planned for NOSDRA Close-out/Certification processes in July 2021.	93
29	057	Integrated Chemical Works Ltd	New Elelenwo Manifold, Akpajo	Eleme	Excavation and treatment of impacted soil.	50
29 LOTS						1,489

SUMMARY OF PERFORMANCE RATINGS	Total Monthly Performance Score (TMPS) for June 2021	1,489
	Average Monthly Performance Score (AMPS) for June 2021	51.34
Performance Ratings from the previous Month for TMPS & AMPS	986	34.00
Monthly Differences (present – previous) for TMPS & AMPS	503	17.34
Percentage Monthly Difference (%)	51.01	
Direction (+ / -) of Monthly Percentage Difference	Positive (+)	

1.3. QUALITY ASSURANCE / QUALITY CONTROL (QAQC) MONITORING OF SITES

An overview of HYPREP's Internal Quality Assurance / Quality Control (QAQC) Monitoring processes undertaken at sites in the Phase 1 Batch 2 Remediation Works to date is provided in Table 1.6 below:

LOT	REMEDIACTION CONTRACTOR	Baseline TPH Values (mg/kg)		TPH values from HYPREP's Internal QA/QC Process (mg/kg) in soil *(Percentage Reduction)		REMARKS
		UNEP	HYPREP	Maximum	Minimum	
023	Cascade Engineering Systems Ltd	-	3,300.00	506.71 (84.65%)	3.37 (99.90%)	Backfilling of excavated trench was approved.
024	Levene Energy Development Ltd		3,880.00	1,253.00 (67.71%)	178.00 (95.41%)	Backfilling was approved after reworking of heaps.
025	Subadom Nigeria Ltd	1,130.00	6,506.00	136.00 (97.91%)	93.59 (98.56%)	Backfilling approved.
026	Ltd	52,900.00	6,366.00	1,013.10 (84.09%)	8.03 (99.87%)	Backfilling was approved after reworking of heaps.
028	Emamed Nig. Ltd	9,200.00	4,344.00	374.10 (91.39%)	87.11 (97.99%)	Backfilling approved.
030	Elizax Bleet Nig Ltd	14,200.00	7,717.00	586.00 (92.41%)	81.00 (98.94%)	Backfilling approved.
031	Oilserv Ltd	-	8,090.00	3,676.50 (54.56%)	478.60 (94.08%)	Backfilling was approved after reworking of heaps.
034	DLK Environmental Services Ltd	-	3,340.00	1,801.00 (46.08%)	72.00 (97.84%)	Backfilling was approved after reworking of heaps.
042	Kannykoy Ltd	-	28,723.00	844.00 (97.06%)	122.00 (99.58%)	Backfilling approved.
043	Otaoilf Services Ltd	-	1,386.00	2,292.00 (-65.37%)	206.00 (85.14%)	Backfilling was approved after reworking of heaps.
045	Chavyn Nig. Ltd	-	18,301.00	63.35 (99.65%)	2.15 (99.99%)	Backfilling approved.
056	Awa Engineering Company Ltd	-	56,468.00	1,778.10 (96.85%)	8.59 (99.98%)	Backfilling was approved after reworking of heaps.
	12 lots					

*Values in green are below DPR target value of 50mg/kg in soil. For values higher than 1000mg/kg in soil, contractor is advised to rework heaps of treated materials prior to backfilling in clean trenches.

Table 1.6: Overview of HYPREP's Internal Quality Assurance / Quality Control (QAQC) Monitoring processes undertaken at sites in the Phase 1 Batch 2 Remediation Project

1.4. NOSDRA CERTIFICATION AND CLOSE-OUT OF REMEDIATION SITES

NOSDRA Close-out / Certification Sampling was carried out at four (4) completed sites in June 2021. The two-weeks exercise involved joint participation of personnel from the National Oil Spill Detection and Response Agency (NOSDRA), Hydrocarbon Pollution Remediation Project (HYPREP), Rivers State Ministry of Environment and Natural Resources (RMENR), Stakeholder Democracy Network (SDN) and the Centre for Environment, Human Rights and Development (CEHRD).

Details of the sites covered in the June 2021 Batch of Sites Sampled by NOSDRA are presented in Table 1.7 below:

S/No	Lot Number	Site	L.G.A	Batch	Remediation Contractor	Number of Samples collected	Close-out/Certification Status
1.	003	NKELEOKEN – ALODE	ELEME	1	PACRIM ENGINEERING NIG. LTD.	63 (60 soil and 3 water) samples.	Awaiting Release of Analytical Results and Recommendations from NOSDRA.
2.	015	WIIEBORSI – KPEAN	KHANA	1	SECURA INVESTMENT LTD.	39 (36 soil and 3 water) samples.	
3.	021	AABUE/UEKEN KOROKORO WELL 6	TAI	1	NEWPAL NIG LTD.	39 (38 soil and 1 water) samples.	
4.	043	ALETO (NGOFA);	ELEME	2	OTAOILF SERVICES LTD.	37 (34 soil and 3 water) samples	

Table 1.7: Sites covered in the June 2021 NOSDRA Remediation Close-out/Certification Process



Plate 1.6: Collection of soil samples by manual slim hole augering during NOSDRA Close-out/Certification sampling at Lot 003 (Nkeleoken –Alode, Eleme L.G.A). Contractor: PACRIM ENGINEERING NIG. LTD.



Plate 1.7: Collection of soil samples by manual slim hole augering during NOSDRA Close-out/Certification sampling at Lot 043, Aleto (Ngofa), Eleme L.G.A). Contractor: OTAOLIF SERVICES NIG. LTD.



Plate 1.8: Fixing of pre-determined sampling points by GIS experts during NOSDRA Close-out/Certification sampling at Lot 021 (Aabue-Ueken, Tai L.G.A).

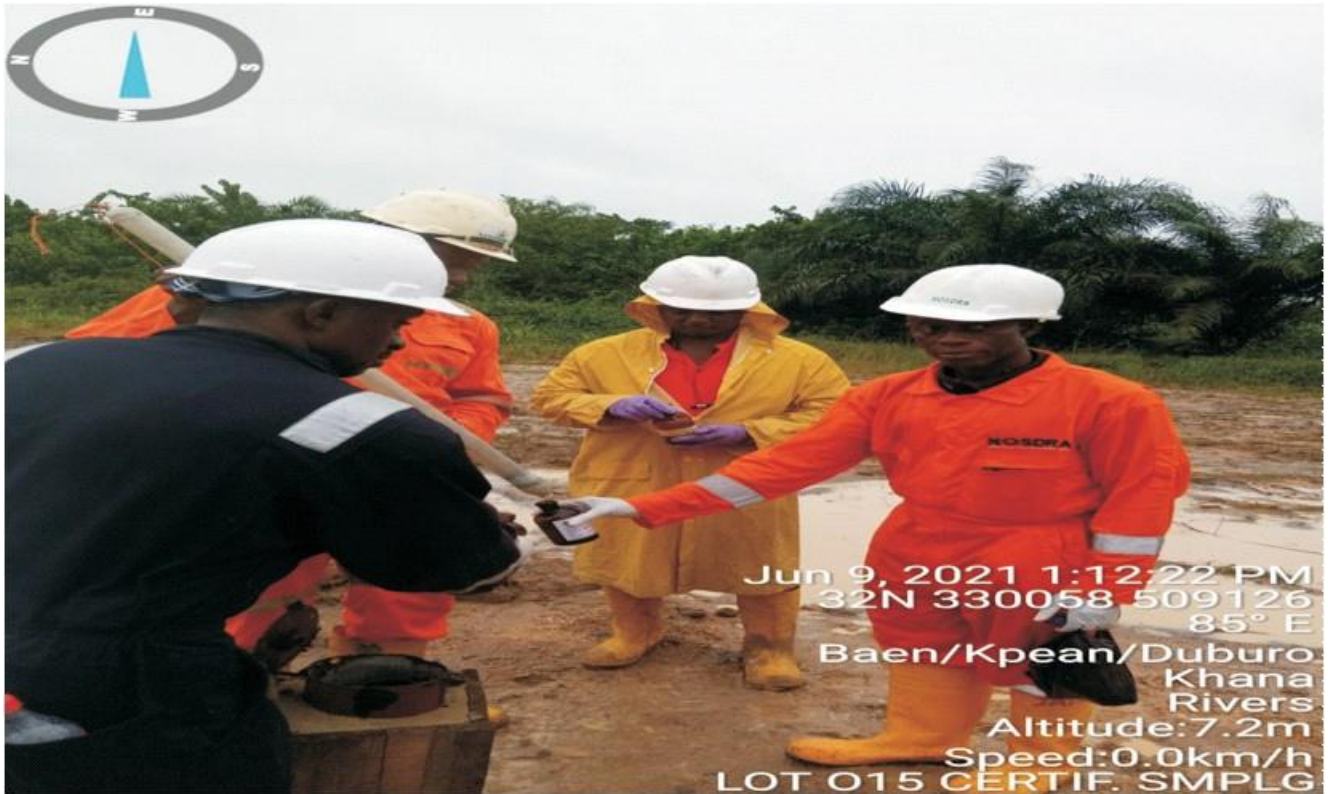


Plate 1.9: Sampling of Groundwater from Installed Defensive Monitoring Wells at Lot 015 Wieborsi, Kpean, Khana L.G.A (Contractor: SECURA INVESTMENTS LTD).

1.5 Summary of Status of Lots in Batch 1 and 2 of Phase 1 Remediation Works is provided in Table 1.8 below:

S/No.	Status	Number of Lots	Lots in Batch 1	Lots in Batch 2*
1	Completed Remediation Works and NOSDRA Closed-out Processes Successfully.	13	001,002,004–008, 010,014,017–020 (13 Lots).	0
2	Completed Remediation Works but awaiting NOSDRA Close-out Results	4	003, 015, 021 (3 Lots).	043 (1 Lot)
3	Planned for NOSDRA Close-out Processes in July 2021	8	009,012 (2 Lots)	024, 026, 030, 042, 045, 056. (6 Lots).
4	Still Working (at different stages)	25	011, 013, 016 (3 Lots)	022, 023, 025, 027 – 029, 031 – 034, 044, 046 – 055, 057 (22 Lots).
		50 Lots	21 Lots	29 Lots
*Lot Numbers 035 – 041 were allocated to Tier 2 Detailed Quantitative Risk Assessment Works.				

Table 1.8: Summary of Status of Lots in Phase 1 Batch 1 & 2 Remediation Works

1.7 HYPREP AREA OFFICES

In order to take HYPREP activities closer to the Ogoni communities and promote support for the Project, the Project Coordination Office (PCO) is constructing an Area Office, at each of the Four (4) Local Government Council premises, comprising; **Khana, Gokana, Tai and Eleme**. This forms part of the milestones to be accomplished by selected Contractors in the Phase 1 Batch 1 Remediation Work.

1.7.1 Progress of Work

(a) Tai LGA: The Contractor has completed the erection of the super structure, installation of the roof covers and structure of the office building. Looking ahead to finishing works on plastering, installation of plumbing, electrical fittings, office doors and windows.



Internal and External Works

(b) Khana LGA: The Contractor has completed the execution of the Super structures, roofing, fittings of doors, windows, electrical piping and plastering. Currently, work is in progress with the installation of POP ceilings. Looking ahead are plumbing, tiling and electrical fitting works.



Fabrication of the POP ceiling and the External Works

(c) Gokana LGA: The Contractor has also completed the erection of the super structure and installation of the roof covers and structure of the office building. Looking ahead to finishing works including plastering, installation of plumbing, electrical fitting and the office doors and windows.



Internal and External Works

(d) Eleme LGA: The Contractor is yet to commence site activities. Development of plans and preparations for mobilization to site are ongoing.

SUMMARY OF WORK PROGRESS

S/N	LGA	CONTRACTOR	STATUS	COMPLETION (%)
1	Khana	Secura Investment Limited	Building structure completed. POP Ceiling works ongoing.	70
2	Gokana	Centennial Development & Investment Limited	Roofing completed.	50
3	Tai	Newline West Africa	Roofing completed.	50
4	Eleme	Giolee Global Resources	Pre-site activities and preparation ongoing	0

1.8 ON-THE-SPOT ASSESSMENT OF WORK AT REMEDIATION SITES

Within the month under review, the Head of Operations and Officer Overseeing the Project Coordination Office (OOPCO) of HYPREP, Prof. Philip Shekwolo, accompanied by Heads of Communications/Community Engagement, Security, representative of SPDC Technical Support team to HYPREP and other Staff undertook inspection visits to some active remediation sites for an on-the-spot assessment of work.

The visit was to monitor the level of work done and the extent of compliance with HYPREP's Standard Operating Protocol. Prof. Shekwolo assured that HYPREP will not compromise the quality of work and insisted that contractors must work according to HYPREP specification.



Plate 2.1: Head, Operations & Officer Overseeing HYPREP PCO at Lot 030 in Korokoro, Tai L.G.A during the HYPREP Management Monitoring Visit. (Contractor: ELZAX BLEET NIG. LTD).



Plate 2.2: Head, Operations & Officer Overseeing HYPREP PCO at Lot 025 at B.Dere/Gio Site in Gokana/Tai L.G.A during the HYPREP Management Monitoring Visit



Plate 2.3: Head, Operations & Officer Overseeing HYPREP PCO examining Contractor's Health, Security, Safety and Environment (HSSE) Statistics at Lot 042 in Korokoro, Tai L.G.A



Plate 2.4: Group Photograph by HYPREP Inspection Team led by OOPCO with the Community. Workers and Site Manager at Lot 29 Korokoro, Tai LGA.

